Trip to Sunshine Coast Queensland, September 2004 Visit to Schools

Report No 2002-059-B No 7

The research described in this report was carried out by CSIRO Project Leader Ivan Cole

Team Members Wayne Ganther David Paterson Gerry Trinidad Wan Yee Chan Tim Muster Penny Corrigan Mary Lou Maher Pak San Liew Michael Ball Alan Carse

Research Program: B Program Name Environmental Sustainability Research Project No.: 2002-059-B Project Name Case Based Reasoning in Construction and Infrastructure Projects

Date: January 2005

Distribution List

Cooperative Research Centre for Construction Innovation

Authors Wayne Ganther

David Paterson Ivan Cole Gerry Trinidad Wan Yee Chan Tim Muster Penny Corrigan Mary Lou Maher Pak San Liew Michael Ball Alan Carse

Disclaimer

The Client makes use of this Report or any information provided by the Cooperative Research Centre for **Construction Innovation** in relation to the Consultancy Services at its own risk. Construction Innovation will not be responsible for the results of any actions taken by the Client or third parties on the basis of the information in this Report or other information provided by Construction Innovation nor for any errors or omissions that may be contained in this Report. Construction Innovation expressly disclaims any liability or responsibility to any person in respect of any thing done or omitted to be done by any person in reliance on this Report or any information provided.

© 2004 Icon.Net Pty Ltd

To the extent permitted by law, all rights are reserved and no part of this publication covered by copyright may be reproduced or copied in any form or by any means except with the written permission of Icon.Net Pty Ltd.

Please direct all enquiries to: Chief Executive Officer Cooperative Research Centre for Construction Innovation 9th Floor, L Block, QUT, 2 George St Brisbane Old 4000 AUSTRALIA T: 61 7 3864 1393 F: 61 7 3864 9151 E: <u>enquiries@construction-innovation.info</u> W: <u>www.construction-innovation.info</u>

Table of Contents

		Page
Table of (Contents	i
List of Fig	gures	ii
EXECUT		1
1 INTR	ODUCTION	2
2 INSP	ECTION AT SCHOOLS	2
2.1	Currimundi State School	3
2.2	Currimundi Special School	14
2.3	Talara Primary College	21
2.4	Kawana Waters State High School	
3 OTH	ER ISSUES RAISED	59
4 ADD	RESS AND CONTACTS FOR SCHOOLS VISITED	59
5 CON	CLUSIONS	60

List of Figures

Figure 1	Maps of Schools	2
Figure 2	Aerial Photograph of Currimundi State School	3
Figure 3	Plan of Currimundi State School	4
Figure 4	Location of salt candle at Currimundi State School	4
Figure 5	Modular 1 Class room at Currimundi State School	5
Figure 6	Rusting and Deterioration on gutter on Modular 1	5
Figure 7	Close up of Figure 6, showing that problems are associated with	6
Figure 8	Sub-floor of Modular 1 showing significant deterioration of sub	6
Figure 0	Stump support of Modular 1	7
Figure 10	Close up of Stump of Modular 1	7
Figure 10	West and of roof of Modular 1	/ Q
Figure 11	Fastanara an roof of Modular 1 abouing rust staining on to	0
Figure 12	sheeting	8
Figure 13	Fasteners on roof of Modular 1 showing rust staining on to sheeting	9
Figure 14	Covered games area	9
Figure 15	Footing of steel support showing red corrosion product	10
Figure 16	End of steel beam showing red rust break through	10
Figure 17	Inside covered games area showing corrosion of underside of	
. gale	roof sheeting and rust on edges of beams	11
Figure 18	Inside covered games area showing corrosion of underside of	
rigare re	roof sheeting and rust on painted gang hail plates	11
Figure 19	Close up of gang nail plates on inside of covered games area	12
Figure 20	Close up of inside of roof sheeting of covered games area	
rigaro 20	showing significant white corrosion product and some red rust	12
Figure 21	Close up of inside of roof sheeting of covered games area	12
rigaro z r	showing significant white corrosion product	13
Figure 22	Currimundi Special School	14
Figure 23	Stainless steel equipment box showing signs of rust where signs	17
rigure 20	were affixed with tape	1/
Figure 24	Close up of covered walkway showing significant white corrosion	17
rigule 24	product possibly aluminium construction	15
Eiguro 25	Covered welkway showing correction of gelveniced support	15
Figure 25	Covered walkway showing conosion of galvanised support	15
Figure 20	undergutting agen on Colorband abacting	16
Figure 07	Covered well-wey factor sharks have red rust and undersutting	10
Figure 27	Covered walkway, laster shanks have red rust and undercutting	40
	Seen on Colorbond Sneeting	16
Figure 28	Covered set down structure	17
Figure 29	Covered set down snowing red rust of stainless steel strapping	
	not in contact with roof sheeting and red rust on roof sheeting	47
F : 0.0	where stainless steel strapping is in contact	17
Figure 30	Close up showing red rust of stainless steel strapping not in	
	contact with root sheeting and red rust on root sheeting where	
-	stainless steel strapping is in contact	18
⊢igure 31	Close up showing red rust of stainless steel strapping not in	
	contact with root sheeting and red rust on roof sheeting where	
	stainless steel strapping is in contact	18

List of Figures cont.

Figure 32	Close up showing red rust on roof sheeting where stainless steel	19
Figure 33	Triple grips on structure of covered set down showing signs of	10
	deterioration and roof fastener shank to red rust	19
Figure 34	Triple grips and bolts on structure of covered set down showing	20
	Signs of deterior allore, well-well-weight are not shown	20
Figure 35	Layout of Talata College, walkways are not shown	21
Figure 36	Faitara Primary College Administration Block	22
Figure 37	Class up of fosteners in shooting on porch of Administration Block	22
Figure 38	Block	23
Figure 39	Galvanised post on Administration Block and close up showing signs of white corrosion product	23
Figure 40	View of the school from the east side showing the Pre-School to	
ligate to	the left and the Junior playaround to the right	24
Figure 41	Red rust on fasteners on Block N	24
Figure 42	Covered court	25
Figure 43	Corroded strapping on covered court	25
Figure 44	Corroded fasteners in covered walkway	26
Figure 15	Corroded fasteners in covered walkway	20
Figure 46	Roof of huilding: heads of fasteners and roof in good condition	20
Figure 40	View from parth of school showing Centre Court and Block G	27
Figure 18	View to walkway from 2 nd floor of Block E	28
Figure 40	Inside gutter of walkway from Block E	20
Figure 50	Roof of covered walkway from Block C showing rust stains from	23
l iguie oo	discarded swarf	29
Figure 51	View of school from 2 nd storey of Block F	30
Figure 52	Degradation of gutter at join	30
Figure 53	Close up of degradation of gutter at join, note pop rivets corroded	00
	away	31
Figure 54	Close up of degradation of gutter at join, note pop rivets corroded	
	away	31
Figure 55	Corroded fastener under covered area, sheeting also showing	
	undercutting	32
Figure 56	Salt candle installation at Talara College Primary School, in Pre-	~~
E : 67	School playground	32
Figure 57	School	33
Figure 58	The Kawana Waters State High School sign outside the school	34
Figure 59	Position of salt candle shelter at Kawana Waters High School	35
Figure 60	View to the south east from the salt candle shelter	35
Figure 61	View to the east from the salt candle shelter.	36
Figure 62	View to the north from the salt candle shelter	36
Figure 63	View of area where salt candle is located	37
Figure 64	Covered walkway showing timber support and steel downpipe	37
Figure 65	Bottom of square section of steel completely rusted away	38
Figure 66	Top of downpipe also showing rusting of bracket from downpipe	
	to support and stainless steel plates on walkway beams	38
Figure 67	Close up of downpipe bracket and stainless steel connector	
0	plate	39
Figure 68	Underside of aluminium roof sheeting of covered walkway	40
Figure 69	Close up of underside of aluminium roof sheeting of covered	
-	walkway	40

List of Figures cont.

Figure 70	Heavily corroded fastener in sheeting of covered walkway	41
Figure 71	Heavily corroded fastener in sheeting of covered walkway	41
Figure 72	Heavily corroded fastener in sheeting of covered walkway	42
Figure 73	Exposed surface of aluminium walkway in good condition, note	
0	cyclone plates	42
Figure 74	Exposed surface of aluminium walkway in good condition	43
Figure 75	Close up of above figure showing fasteners with red rust	43
Figure 76	Exposed surface of aluminium walkway in good condition	44
Figure 77	Exposed surface of aluminium walkway in good condition	44
Figure 78	Close up fasteners showing red rust and white corrosion product	45
Figure 79	Colorbond walkways with aluminium gutters	45
Figure 80	Colorbond walkways with aluminium gutters which are full of leaves.	46
Figure 81	Colorbond walkway	46
Figure 82	Colorbond walkway with aluminium gutters and stainless steel fasteners and aluminium cyclone plates	47
Figure 83	Inside autters, although dirty looked to be in OK condition	47
Figure 84	Inside gutters, although dirty looked to be in OK condition	48
Figure 85	Inside gutters, although dirty looked to be in OK condition	40
Figure 86	Inderside of all autters were significantly corroded	40 70
Figure 87	Underside of all guilters	49
Figure 88	Underside of Colorbond walkways in good condition, some	49
Figure oo	deterioration of pointed steel supports	50
Eiguro 90	Close up of pointed steel supports showing some deterioration of	50
Figure 69	paint and some break through of rust and white corrosion	50
E	product	50
Figure 90 Figure 91	Joint between two walkways showing the use of galvanised	51
E	tiasning which has significant white corrosion product	51
Figure 92	Shank of stainless steel fastener in Colorbond walkway, no deterioration	52
Figure 93	Colorbond sheeting and aluminium gutter showing significant	52
Figure 94	Colorbond sheeting and aluminium gutter showing significant	52
riguic 54	arowths	53
Figure 95	Deterioration around joint between gutter and downnine	53
Figure 96	Structural downpipes	5/
Figure 97	Structural downpipes	55
Figure 97	Structural downpipes	55
rigule 30	ioin to the gutter and the infill papel has water damage	56
Figure 00	Structural downping showing that water has come through the	50
rigule 33	ioin to the gutter and the infill papel has water damage	56
Eiguro 100	Structural downpring showing that water has come through the	50
Figure 100	since the gutter and red rust can be seen in the LL section	57
Eiguro 101	Page of the downpipe	57
Figure 101	Last of the upwilpipe	57
Figure 102	along stool	50
Eigure 102	aluly sleet	58
i igule 103	been which is rotting	50
Figure 104	Close up of L section showing significant rod rust	50
1 1941 8 104	Close up of a section showing significant red rust	09

EXECUTIVE SUMMARY

A trip was undertaken to look at concerns of Public Works and Main Roads Departments of Queensland. David Paterson and Wayne Ganther from CSIRO travelled to the Sunshine Coast with Alan Carse of Queensland Department of Main Roads and Michael Ball of Queensland Department of Public Works. We were also joined for part of the visits by Ed Bowers of QBuild which is a commercial unit of Public Works responsible for maintenance of Public Works.

During the trip we visited a bridge on the David Low Way at Sunrise Beach near Noosa. This bridge was in a severe marine environment with high salt content in the concrete and corrosion of the galvanised handrails and barriers. This is discussed in the *Visit to Bridge and Foreshore* Report 2002-059-B No 8.

This report covers the visit to four schools north of Caloundra.

- Currimundi State School and Currimundi Special School which are located within 100 metres of the ocean at Dicky Beach, Currimundi and have significant corrosion problems.
- Talara Primary College which is approximately 2 km inland from Dicky beach west of the Currimundi Schools.
- Kawana State High School

All of the schools have significant corrosion problems. Most of the corrosion issues relate to sheltered corrosion and have been seen in similar structures in Victoria. The main structures affected are covered walkways and shelters ie. all areas where salt can be deposited and is not washed away. Another problem is roof fasteners which have corroded; this may be due to inappropriate specifications as some fasteners were stainless steel and performing well. Other corrosion problems are due to inappropriate design, specifications or building practice.

1 INTRODUCTION

As part of the CRC for Construction Innovation project on Case Based Reasoning a trip was undertaken to look at concerns of Public Works and Main Roads Departments of Queensland, these organisations being the project's industrial partners. David Paterson and Wayne Ganther from CSIRO travelled to the Sunshine Coast with Alan Carse of Queensland Department of Main Roads and Michael Ball of Queensland Department of Public Works. We were also joined for part of the visits by Ed Bowers of QBuild which is a commercial unit of Public Works responsible for maintenance of Public Works. The Sunshine Coast area was chosen for the visit due its coastal location and known corrosion problems.

2 INSPECTION AT SCHOOLS

Four schools were visited on the Sunshine Coast, Currimundi State School, Currimundi Special School, Talara Primary College and Kawana Waters State High School.



Figure 1 Maps of Schools

2.1 Currimundi State School

Currimundi State School is located within a couple of hundred metres of the beach as seen in

Figure 2. The school was opened in 1977 and the buildings shown are between 4 and 12 years old.

The main issues seen here were corrosion and deterioration of Colorbond gutters around joins and fastening points, corrosion of metallic components in sheltered areas, metal building supports in sub floor and gang nails in roof areas, and corrosion of roof fasteners. There was also substantial corrosion on the underside of roof sheeting of walkways and covered play areas. The exposed roof surfaces looked to be in good condition. We did not look inside the roof spaces of any of the buildings. At this school we installed a salt candle which will be changed by the students over the next couple of months.



Figure 2 Aerial Photograph of Currimundi State school



Figure 3 Plan of Currimundi State School



Figure 4 Location of Salt Candle at Currimundi State School



Figure 5 Modular 1 class room at Currimundi State School



Figure 6 Rusting and deterioration on gutter on Modular 1



Figure 7 Close up of rusting and deterioration on gutter on Modular 1 showing that problems are associated with the joints.



Figure 8 Sub-floor of Modular 1 showing significant deterioration of sub floor metallic components.



Figure 9 Stump support of Modular 1.



Figure 10 Close up of stump of Modular 1.



Figure 11 West end of roof of Modular 1.



Figure 12 Fasteners on roof of Modular 1 showing rust staining on to sheeting.



Figure 13 Fasteners on roof of Modular 1 showing rust staining on to sheeting.



Figure 14 Covered games area.



Figure 15 Footing of steel support showing red corrosion product.



Figure 16 End of steel beam showing red rust break through.



Figure 17 Inside covered games area showing corrosion of underside of roof sheeting and rust on edges of beams.



Figure 18 Inside covered games area showing corrosion of underside of roof sheeting and rust on painted gang nail plates.



Figure 19 Close up of gang nail plates on inside of covered games area.



Figure 20 Close up of inside of roof sheeting of covered games area showing significant white corrosion product and some red rust.



Figure 21 Close up of inside of roof sheeting of covered games area showing significant white corrosion product.

2.2 Currimundi Special School

The Special school is located across the road from the State School. The school was opened in 1984. It has the same sorts of problems as the State school. It is in the process of being rebuilt and there are some problems with the installation of some components.



Figure 22 Currimundi Special School.



Figure 23 Stainless steel equipment box showing signs of rust where signs were affixed with tape.



Figure 24 Close up of covered walkway showing significant white corrosion product, possibly aluminium construction.



Figure 25 Covered walkway showing corrosion of galvanised support.



Figure 26 Covered walkway, fastener shanks are red rust and undercutting seen on Colorbond sheeting.



Figure 27 Covered walkway, fastener shanks are red rust and undercutting seen on Colorbond sheeting.

The following figures show an attempt at building with more corrosion resistant components but actually causing additional problems. Stainless steel strapping was used in the construction of the Covered set down but it is in contact with the Colorbond roof sheeting. The strap that is not in contact is corroding and the strap in contact with the Colorbond is causing the Colorbond to corrode. The Colorbond is showing significant red rust and will in the near future if it hasn't already, corrode through. This could have been avoided by making sure the strapping did not touch the Colorbond sheeting.



Figure 29 Covered set down showing red rust of stainless steel strapping not in contact with roof sheeting and red rust on roof sheeting where stainless steel strapping is in contact.



Figure 30 Close up showing red rust of stainless steel strapping not in contact with roof sheeting and red rust on roof sheeting where stainless steel strapping is in contact.



Figure 31 Close up showing red rust of stainless steel strapping not in contact with roof sheeting and red rust on roof sheeting where stainless steel strapping is in contact.



Figure 32 Close up showing red rust on roof sheeting where stainless steel strapping is in contact.



Figure 33 Triple grips on structure of covered set down showing signs of deterioration and roof fastener shank to red rust.



Figure 34 Triple grips and bolts on structure of covered set down showing signs of deterioration.

2.3 Talara Primary College

This school is located approximately 2 kilometres from the coast almost directly west of the Currimundi schools. The school was opened in 1998 and Block E was only opened in 2004. It also shows the same issues as the other schools. A salt Candle was installed here and will be changed by the students.



Figure 35 Layout of Talara College, walkways are not shown.



Figure 36 Talara Primary College Administration Block.



Figure 37 Fasteners in sheeting on porch of Administration Block.



Figure 38 Close up of Fasteners in sheeting on porch of Administration Block.



Figure 39 Galvanised post on Administration Block and close up showing signs of white corrosion product.



Figure 40 View of the school from the east side showing the Pre-School to the left and the Junior playground to the right.



Figure 41 Rust on fasteners on Block N.



Figure 42 Covered court.



Figure 43 Corroded strapping on covered court.



Figure 44 Corroded fasteners in covered walkway.



Figure 45 Corroded fasteners in covered walkway.



Figure 46 Roof of building, heads of fasteners and roof in good condition.



Figure 47 View from north of school showing Centre Court and block G.



Figure 48 View to walkway from 2nd floor of Block E.



Figure 49 Inside gutter of walkway from block E.



Figure 50 Roof of covered walkway from block G showing rust stains from discarded swarf.



Figure 51 View of school from 2nd storey of Block E.



Figure 52 Degradation of gutter at join.



Figure 53 Close up of degradation of gutter at join, note pop rivets corroded away.



Figure 54 Close up of degradation of gutter at join, note pop rivets corroded away.



Figure 55 Corroded fastener under covered area, sheeting also showing undercutting.



Figure 56 Salt candle installation at Talara College Primary School, in Pre-School playground.



Figure 57, View from Salt candle installation at Talara College Primary School.

2.4 Kawana Waters State High School

This school is approximately 1 kilometre from the coast and approximately 4 kilometres north of Currimundi. The school was opened in 1986. The school has similar problems to the other schools in terms of sheltered corrosion and selection of roof fasteners, but also shows examples of good used of materials as well as inappropriate but well intentioned use of materials.

A salt candle was installed here and will be changed by the students.



Figure 58 The Kawana Waters State High School sign outside the school.



Figure 59 Position of Salt candle shelter at Kawana Waters High School.



Figure 60 View to the South east from the salt candle shelter.



Figure 61 View to the East from the salt candle shelter.



Figure 62 View to the North from the salt candle shelter.



Figure 63 View of area where salt candle is located.

On some covered walkways square section steel was used as downpipes. It is assumed the steel was used as standard downpipes would be destroyed by the students. It can be seen in the following figures that the painted steel is corroding from the inside out.



Figure 64 Covered walkway showing timber support and steel down pipe.



Figure 65 Bottom of square section, steel completely rusted away.



Figure 66 Top of downpipe also showing rusting of bracket from downpipe to support and stainless steel plates on walkway beams.



Figure 67 Close up of downpipe bracket and stainless steel connector plate.

The aluminium sheeting used on the walkways looked ok on the exposed outer surface but underneath there was significant corrosion. It looked like galvanised fasteners were used to fasten the sheeting and these where corroded on the heads, some to 100% red rust. The shanks of all the fasteners where heavily corroded.

The colorbond walkways looked newer than the aluminium ones. The colorbond showed no signs of deterioration on the exposed surface or underneath, although there was significant biological growth on the colorbond. The fasteners used were stainless steel with aluminium cyclone plates and these were in good condition on the heads and shanks. There was no undercutting of the colorbond.

All the aluminium gutters showed corrosion on the underneath side, even on the colorbond walkways. As with the other schools where joins were made in the gutters significant deterioration had occurred.



Figure 68 Underside of aluminium roof sheeting of covered walkway.



Figure 69 Close up of underside of aluminium roof sheeting of covered walkway.



Figure 70 Heavily corroded fastener in sheeting of covered walkway.



Figure 71 Heavily corroded fastener in sheeting of covered walkway.



Figure 72 Heavily corroded fastener in sheeting of covered walkway.



Figure 73 Exposed surface of aluminium walkway in good condition, note cyclone plates.



Figure 74 Exposed surface of aluminium walkway in good condition.



Figure 75 Close up of above figure showing fasteners with red rust.



Figure 76 Exposed surface of aluminium walkway in good condition.



Figure 77 Exposed surface of aluminium walkway in good condition.



Figure 78 Close up of fasteners showing red rust and white corrosion product.



Figure 79 Colorbond walkways with aluminium gutters.





Figure 81, Colorbond walkway.



Figure 82 Colorbond walkway with aluminium gutters and stainless steel fasteners and aluminium cyclone plates.



Figure 83 Inside gutters, although dirty, looked to be in OK condition.



Figure 84 Inside gutters, although dirty, looked to be in OK condition.



Figure 85 Inside gutters, although dirty, looked to be in OK condition.



Figure 86 Underside of all gutters were significantly corroded.



Figure 87 Underside of gutters.



Figure 88 Underside of Colorbond walkways in good condition, some deterioration of painted steel supports.



Figure 89 Close up of painted steel supports showing some deterioration of paint and some break through of rust and white corrosion product.



Figure 90 White corrosion product on painted steel brackets.



Figure 91 Joint between two walkways showing the used of galvanised flashing which has significant white corrosion product.



Figure 92 Shank of stainless steel fastener in Colorbond walkway, no deterioration.



Figure 93 Colorbond sheeting and aluminium gutter showing significant growths.



Figure 94 Colorbond sheeting and aluminium gutter showing significant growths.



Figure 95 Deterioration around joint between gutter and downpipe (note loss of rivet heads).

Another problem seen at this school is the use of structural downpipes. This is where as seen in the following figures the downpipe forms part of the structure holding up the eaves of the building. There is a steel U section around the edge of the eave with a piece of timber inside it. The U section is bolted to the downpipe. What seems to be happening is that the gutters, which are a fairly small diameter, block up. The water then overflows at the downpipe onto the U section and corrodes the U section and the timber is wet helping the corrosion. It was said that it costs \$80,000 to replace the steel U sections on one building.



Figure 96 Structural downpipes.



Figure 97 Structural downpipes.



Figure 98 Structural downpipe showing that water has come through the join to the gutter and the infill panel has water damage.



Figure 99 Structural downpipe showing that water has come through the join to the gutter and the infill panel has water damage.



Figure 100 Structural downpipe showing that water has come through the join to the gutter and red rust can be seen in U section.



Figure 101 Base of the downpipe.



Figure 102 Looking at U section from under the eave, red rust can be seen along steel.



Figure 103 Close up of U section, red rust can be seen and also the wood beam which is rotting.



Figure 104 Close up of U section showing significant red rust.

3 OTHER ISSUES RAISED

The use of fasteners without cyclone plates was noted. As corrosion of the shanks of roof fasteners was seen and undercutting of the roof sheeting, the concern was raised that if a cyclone or other severe weather event hit this region the fasteners could fail or the roof sheeting could fail resulting in the roof sheeting lifting.

4 ADDRESS AND CONTACTS FOR SCHOOLS VISITED

Currimundi State School Principal Richard Wilkinson ph (07) 54366888 Email <u>rwilk30@eq.edu.au</u> Install Salt Test Teacher visited Bevan Hore Addresses Currimundi State School 17 Buderim Street Caloundra Q 4551

Postal address Currimundi State School PO BOX 159 Caloundra Q 4551

Currimundi Special School Principal Alwin Green ph (07) 54913684 No Salt Test

Talara Primary College Principal Steve Adams ph (07) 54936155 Registrar Kerry Natoli Email <u>knato2@eq.edu.au</u> Install Salt test Teacher Visited Sandra Chaplin (Email <u>schap46@eq.edu.au</u>) Postal address PO Box 3707, Caloundra DC 4551 Delivery address Talara Street, Currimundi 4551

Kawana State High School Principal Joe Hause ph (07) 54933388 Registrar Deb Egan Email <u>degan4@eq.edu.au</u> Install Salt Test Teacher Visited Jim Bailey Head of Department - Science.

Postal address: Kawana Waters State High School P.O. Box 84 WURTULLA QLD 4575

Delivery address: Sportsmans Parade BOKARINA QLD 4575

5 CONCLUSIONS

At the Schools, all of the corrosion problems were due to inappropriate design, specifications or building practice, individually or in combination.

As far as gutters are concerned the problems were from sheltered corrosion or installation practice. Sheltered corrosion is where the underside of the gutters are heavily corroded due to the accumulation of deposited salts. The salts accumulate as the under side of the gutters are sheltered from the rain. The insides of the gutters seemed to be in an appropriate condition. Installation practice included problems associated with joins including the cutting of the guttering and joining by pop rivets

and fasteners. The only problems seen with Colorbond® gutters were with installation practice.

Roof sheeting was also mainly affected by sheltered corrosion. That is the top side of the sheeting was in good condition but where exposed, the underside was corroding significantly. Some of the roofs had all the fastener heads to red rust. Exposed fastener shanks were also to red rust. These fasteners looked to be galvanised and the class could not be identified at this time. These fasteners were also causing undercutting of the roof sheeting on Colorbond® roofs. Roofs with stainless steel fasteners looked in good condition.